


[illegible]

SL NO.	TRACK SECTION	FROM	TO	RESETTING		PLACEMENT		MISCON		COOPERATION WITH SIGN FOR RESETTING	DUAL DETECTED BY AFTC NO.
				TYPE	BOX	LV BOX	DOO	CLEAR			
U P L I N E	1. TS-2363	DP-2305	DP-2203	AUTO	KMDI	-	R	G	-	2363AT+2363T+2263AT	
	TS-SUP 25 +TS2363+TS2263 (TS2216)	DP-2305	DP-2105 (KMDI)	PREP	KKHG	KMNB	R	G	KMDI	-	
	3. TS-2361	DP-2301	DP-2307	AUTO	KKHG	-	R	G	-	2361AT+2361T+2363AT	
	4. TS-2463	DP-2401	DP-2303	AUTO	KKHG	-	R	G	-	2463AT+2463T+2361AT	
	TS-SUP 27 +TS2361+TS2463	DP-2401	DP-2307	PREP	KKHG	KMNB	R	G	KKHG	-	

नेताजी भवन
NETAJI BHAVAN

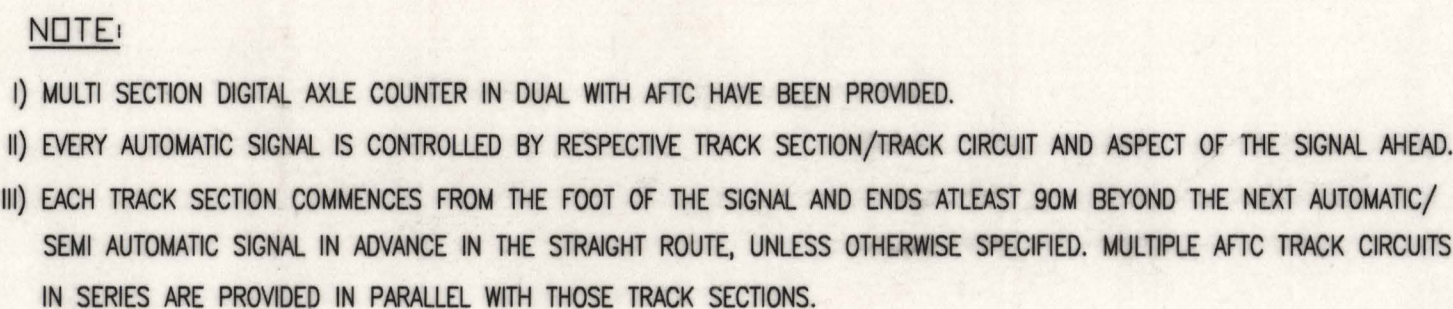

IV) MAGNETO TELEPHONES ARE PROVIDED AT PANEL ROOM AND THEY ARE CONNECTED WITH PANEL ROOMS OF MAIDAN AND KALGHAT.

V) MAGNETO PHONES ARE ALSO PROVIDED AT THE FOOT OF THE DESPATCH SIGNAL NO. AS-2264 IN SECTION KMDI-KNBN AND SIGNAL NO. AS-2463 IN SEC KKHG-KNBN FOR COMMUNICATION BETWEEN MOTORMAN AT D CLASS STATION AND PANEL OPERATOR.

VI) CONTROL TELEPHONES ARE PROVIDED WITH PANEL, SM, MM AND TS/SS ROOMS.

VII) LED LAMPS ARE PROVIDED FOR SIGNAL LIGHTING AND LED 'A' MARKERS ARE PROVIDED IN SEMI AUTOMATIC SIGNALS.

PANEL CABIN

MAIN SIGNAL BUTTONS-S2361,S2362,S2363,S2364

METRO RAILWAY KOLKATA	APPROVED		CHECKED		DRAWN	CRS SANCTION	S C A L E	SIGNAL INTERLOCKING PLAN SEMI AUTOMATIC SIGNAL WITH PANEL WORKING CLASS-SPL,STD-II(r)	NETAJI BAVAN	DRG. No.:- SIP 0923 06	
							1) No. 3601/09/VIII/Pt-I 1330 Dt. 05.03.2012 2) No. MRTS/SG-507/27 Pt. XII. Dt. 19.04.2013 of CSTE/METRO RAILWAY.				LONGITUDINAL : 1:1000 TRANSVERSE : 1:500
	D. MEMBER		W.D.K. BAGE	K.C. PAUL	D. DALLU	D.N. CHAKRABORTY					
	For COM	For CSTE	SSTE/PLG	ASTE/C	SSE/S/PLG	SSE/DRG/S&T					